WIRING INSTRUCTIONS

WARNING: To prevent electrocution, make sure the cord is not connected to a power source before installing the wiring device. Failure to comply with the following instructions could cause an electrical failure or fire.

SALT WATER IMMERSION

DISCONNECT FROM POWER SOURCE. RINSE PLUG/CONNECTOR THOROUGHLY IN FRESH WATER, SHAKE OR BLOW OUT EXCESS WATER, AND ALLOW TO DRY. SPRAY WITH MOISTURE DISPLACEMENT BEFORE RE-USE. Use in wet condition we strongly recommend use of weatherproof covers (102N, 103RN, or 103ELN).

Note: Use round-jacketed cable with diameter from .300 in. (18/3 SJ) through .720 in. (10/3 S).


Note: Be sure to put boot (wing device cover) on cord before wing.

Back out the three recessed screws and separate sections.



4 Recouple the two sections by aligning the key with the key slot.



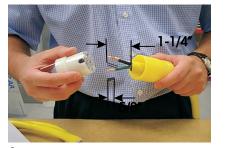

2 Slide housing over cord. Strip 5/8 in. of insulation off each of the three wires. Make sure the wire is clean and a bright copper color. Do not solder the ends of the wire.



5 Tighten down the recessed screws with moderate torque.



3 Insert bare wires into their corresponding color-coded terminals. Make certain there is not wire insulation under any terminal clamp. Tighten the screw clamps to 14-20 inch-pounds torque.



6 Tighten cord clamp by tighten two assembly screws to 16-20 inch-pounds torque.

2655 Napa Valley Corporate Drive Napa, CA 94558 (707) 226-8600 FAX: (707) 226-9670 For these instructions and more information please check website: www.marinco.com 200745 REV. 00.

WIRING INSTRUCTIONS

WARNING: To prevent electrocution, make sure the cord is not connected to a power source before installing the wiring device.

Failure to comply with the following instructions could cause an electrical failure or fire.

SALT WATER IMMERSION

DISCONNECT FROM POWER SOURCE. RINSE PLUG/CONNECTOR THOROUGHLY IN FRESH WATER, SHAKE OR BLOW OUT EXCESS WATER, AND ALLOW TO DRY. SPRAY WITH MOISTURE DISPLACEMENT BEFORE RE-USE. Use in wet condition we strongly recommend use of weatherproof covers (102N, 103RN, or 103ELN).




] Back out the three recessed screws and separate sections.



4 Recouple the two sections by aligning the key with the key slot.



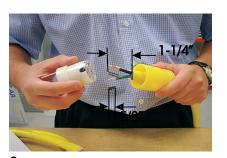

2 Slide housing over cord. Strip 5/8 in. of insulation off each of the three wires. Make sure the wire is clean and a bright copper color. Do not solder the ends of the wire.



5 Tighten down the recessed screws with moderate torque.

Note: Use round-jacketed cable with diameter from .300 in. (18/3 SJ) through .720 in. (10/3 S).



3 Insert bare wires into their corresponding color-coded terminals. Make certain there is not wire insulation under any terminal clamp. Tighten the screw clamps to 14-20 inch-pounds torque.



6 Tighten cord clamp by tighten two assembly screws to 16-20 inch-pounds torque.

2655 Napa Valley Corporate Drive